Your Inspection Report



82 Salem Ave Toronto, ON M6H 3C1



PREPARED FOR:
ROGER TRAVASSOS

INSPECTION DATE: Friday, September 5, 2025

PREPARED BY:
Jonathan Dube



Carson, Dunlop & Associates Ltd. 120 Carlton Street, Suite 407 Toronto, ON M5A 4K2 416-964-9415

www.carsondunlop.com inspection@carsondunlop.com



September 19, 2025

Dear Roger Travassos,

RE: Report No. 93897, v.2 82 Salem Ave Toronto, ON M6H 3C1

Thank you for choosing us to perform your home inspection. We hope the experience met your expectations.

The enclosed report includes an Overview tab which summarizes key findings, and the report body. The Good Advice tab provides helpful tips for looking after your home; and the Appendix tab includes valuable added benefits. You can navigate by clicking the tabs at the top of each page.

TO THE PROSPECTIVE BUYER: We strongly recommend an Onsite Review of the home to help you understand the inspection report and protect your investment. The Review includes a tour of the home with the inspector, a complimentary safety recall service on appliances and ensures that you can take advantage of the special offers listed in the appendix most of them are free. You also receive free technical support for as long as you own your home. The Onsite Review fee is \$260.

Thanks again for choosing Carson Dunlop

Sincerely,

Jonathan Dube on behalf of Carson, Dunlop & Associates Ltd.

www.carsondunlop.com

OVERVIEW

82 Salem Ave, Toronto, ON September 5, 2025

OVERVIEW ROOFING EXTERIOR STRUCTURE ELECTRICAL HEATING COOLING INSULATION PLUMBING INTERIOR

RECALCHEK OUR ADVICE APPENDIX REFERENCE

This Overview lists some of the significant report items if any were identified. Please read the entire report before making any decisions about the home; do not rely solely on the Overview.

FOR THE BUYER

There are two elements to a home inspection - the inspection itself and the report. This report is helpful, but the inspection is equally important. You need both elements to make an informed decision. Call us at 416-964-9415 to book a Buyers Review with the inspector . Our fee is \$260. Without a Buyers Review, our obligation and liability are limited to the seller.

When you move into the home you may find some issues not identified in the report. That is to be expected for a few reasons, such as furniture and storage that has been removed, changes to the property conditions, etc. Therefore, we suggest you allow roughly 1% of the value of the home annually for maintenance and repair.

Cooling & Heat Pump

AIR CONDITIONING \ Life expectancy

Condition: • Air conditioner near the end of typical life expectancy

Although the air conditioning systems are close to the end of their life, continue to use and maintain the units until they fail. Be prepared to replace at any time.

Task: Replace

Time: When necessary Cost: \$3,000 - \$6,000 each

Here are a few thoughts to help you stay warm, safe and dry in your home.

All homes require regular maintenance and periodic updates. Maintenance programs help keep homes safe, comfortable and efficient. Roofs, furnaces and air conditioners for example, wear out and have to be replaced. Good maintenance extends the life of these house systems. Refer to Our Advice tab for more details regarding maintenance of your home.

Water is the biggest enemy of homes, whether from leaks through the roof, walls or foundation, or from plumbing inside the home. Preventative maintenance and quick response to water problems are important to minimize damage, costs and help prevent mould.

Environmental consultants can help with issues like mould, indoor air quality and asbestos. If you need help in these areas, we can connect you with professionals.

All recommendations in the report should be addressed by qualified specialists. Our ballpark costs and time frames are provided as a courtesy and should be confirmed with quotes from specialists. Minor costs in the report are typically under \$1,000.

END OF OVERVIEW

ROOFING

82 Salem Ave, Toronto, ON September 5, 2025

www.carsondunlop.com

OVERVIEW ROOFING EXTERIOR STRUCTURE ELECTRICAL HEATING COOLING INSULATION PLUMBING INTERIOR

RECALCHEK OUR ADVICE APPENDIX REFERENCE

Description

Sloped roofing material:

Asphalt shingles
 Front roofs and peak



Asphalt shingles


Asphalt shingles

Flat roofing material:

• Modified bitumen membrane



Upper flat roof

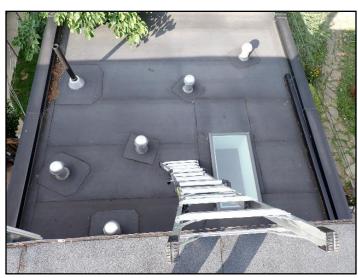

Lower rear roof

ROOFING

82 Salem Ave, Toronto, ON September 5, 2025

www.carsondunlop.com

OVERVIEW ROOFING EXTERIOR STRUCTURE ELECTRICAL HEATING COOLING INSULATION PLUMBING INTERIOR

RECALCHEK OUR ADVICE APPENDIX REFERENCE

Observations and Recommendations

RECOMMENDATIONS \ General

Condition: • The roof coverings are in good overall condition. Annual inspections are recommended (on any roof) to take care of any roof damage and/or regular maintenance items (flashings/caulking).

FLAT ROOFING \ Built-up

Condition: • Tree branches touching roof

Location: Rear

Task: Trim tree branches **Time**: Regular maintenance

Cost: Minor



Tree branches touching roof

Inspection Methods and Limitations

Inspection performed: • By walking on roof

Age determined by: • Visual inspection from roof surface

EXTERIOR

82 Salem Ave, Toronto, ON September 5, 2025

www.carsondunlop.com

OVERVIEW ROOFING EXTERIOR STRUCTURE ELECTRICAL HEATING COOLING INSULATION PLUMBING INTERIOR

RECALCHEK OUR ADVICE APPENDIX REFERENCE

Description

Wall surfaces and trim: • Brick • Fiber cement siding

Observations and Recommendations

WALLS \ Masonry (brick, stone) and concrete


Condition: • Mortar deterioration

The brickwork is in good condition overall. However, spalling bricks and localized mortar deterioration was noted.

Location: Various

Task: Touch up masonry

Time: As needed Cost: \$1,000 and up

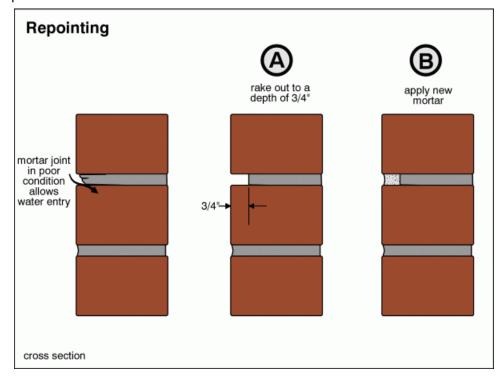

EXTERIOR

82 Salem Ave, Toronto, ON September 5, 2025

www.carsondunlop.com

OVERVIEW ROOFING EXTERIOR STRUCTURE ELECTRICAL HEATING COOLING INSULATION PLUMBING INTERIOR

RECALCHEK OUR ADVICE APPENDIX REFERENCE



Mortar deterioration



Mortar deterioration



Right side



Right side - front

EXTERIOR

82 Salem Ave, Toronto, ON September 5, 2025

www.carsondunlop.com

OVERVIEW ROOFING EXTERIOR STRUCTURE ELECTRICAL HEATING COOLING INSULATION PLUMBING INTERIOR

RECALCHEK OUR ADVICE APPENDIX REFERENCE



Spalling brick - Right side front

LANDSCAPING \ Walkway

Condition: • Unsealed gap at building

Location: Right side

Task: Seal

Time: As soon as practical

Cost: Minor



Unsealed gap at building



Unsealed gap at building

EXTERIOR

82 Salem Ave, Toronto, ON September 5, 2025

www.carsondunlop.com

OVERVIEW ROOFING EXTERIOR STRUCTURE ELECTRICAL HEATING COOLING INSULATION PLUMBING INTERIOR

RECALCHEK OUR ADVICE APPENDIX REFERENCE

Inspection Methods and Limitations

Exterior inspected from: • Ground level

STRUCTURE

82 Salem Ave, Toronto, ON September 5, 2025

www.carsondunlop.com

OVERVIEW ROOFING EXTERIOR STRUCTURE ELECTRICAL HEATING COOLING INSULATION PLUMBING INTERIOR

RECALCHEK OUR ADVICE APPENDIX REFERENCE

Description

Configuration: • Basement

Foundation material: • Poured concrete • Masonry block • Not visible in areas

Floor construction: • Joists • Subfloor - plank

Exterior wall construction:

• Wood frame / Masonry veneer

Rear addition (Exterior Insulation and Finishing System EIFS - Stucco)

• Masonry

Roof and ceiling framing: • Not visible

Party wall: • Not visible

Observations and Recommendations

RECOMMENDATIONS \ General

Condition: • Most foundation walls and masonry walls have small cracks due to minor shrinkage, settlement or shifting. These will not be individually noted, unless leakage or building movement is noted.

FLOORS \ Concrete slabs

Condition: • Concrete basement, crawlspace and garage floors are not typically part of the structure. Almost all basement, crawlspace and garage concrete floors have minor shrinkage and settlement cracks.

ROOF FRAMING \ Attic/roof space

Condition: • No access to roof space

Inspection Methods and Limitations

Attic/roof space: • Flat roof space - no access

ELECTRICAL

82 Salem Ave, Toronto, ON September 5, 2025

www.carsondunlop.com

OVERVIEW ROOFING EXTERIOR STRUCTURE ELECTRICAL HEATING COOLING INSULATION PLUMBING INTERIOR

RECALCHEK OUR ADVICE APPENDIX REFERENCE


Description

Service size: • 100 Amps (240 Volts)

Main disconnect/service box type and location:

• Breakers - basement



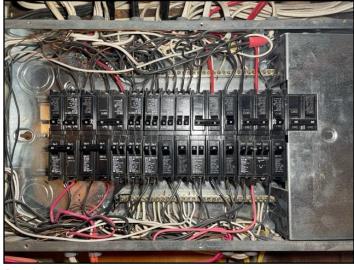

Breakers - basement

Breakers - basement

Distribution wire (conductor) material and type: • <u>Copper - non-metallic sheathed</u> • <u>Copper - metallic sheathed</u>

Circuit interrupters: Ground Fault (GFCI) & Arc Fault (AFCI): • GFCIs present • No AFCI

Observations and Recommendations

RECOMMENDATIONS \ General

Condition: • All electrical recommendations are safety issues. Treat them as high priority items, and consider the Time frame as Immediate, unless otherwise noted.

DISTRIBUTION SYSTEM \ Knob-and-tube wiring (wires)

Condition: • <u>Although no active knob-and-tube wiring was noted there may be some present based on the age of the home.</u> Click on the line above to see the Ontario Electrical Safety Authority's position on this wiring system.

Inspection Methods and Limitations

General: • A natural gas fueled backup generator is installed.

Inspection of such a system is beyond the scope of a home inspection.

ELECTRICAL

82 Salem Ave, Toronto, ON September 5, 2025

www.carsondunlop.com

OVERVIEW ROOFING EXTERIOR STRUCTURE ELECTRICAL HEATING COOLING INSULATION PLUMBING INTERIOR

RECALCHEK OUR ADVICE APPENDIX REFERENCE



Generator

Inspection limited/prevented by: • Main disconnect cover not removed - unsafe to do so.

HEATING

82 Salem Ave, Toronto, ON September 5, 2025

OVERVIEW ROOFING EXTERIOR STRUCTURE ELECTRICAL HEATING COOLING INSULATION PLUMBING INTERIOR

RECALCHEK OUR ADVICE APPENDIX REFERENCE

Description

General: • The boiler should have several years of life remaining.

Heating system type:

• Integrated (combination) system

The tankless combination boiler/water heater provides both heat and domestic hot water



Integrated (combination) system

Fuel/energy source: • Gas

Approximate capacity: • 110,000 BTU/hr

Efficiency: • High-efficiency

Approximate age: • Not determined

Typical life expectancy: • Boiler (steel) 20 to 25 years

Auxiliary heat: • Radiant heater (towel warmer)

Fireplace/stove: • Wood-burning fireplace - not in service

Observations and Recommendations

RECOMMENDATIONS \ General

Condition: • It is common to feel the airflow stronger at some registers, depending on the length of the ductwork and the number of turns required to get there. Different preferences and seasons often necessitate different setups (balancing). A service agreement that covers parts and labour (for heating and cooling equipment) is typically advised.

Location: Throughout **Task**: Monitor / improve

COOLING & HEAT PUMP

82 Salem Ave, Toronto, ON September 5, 2025

www.carsondunlop.com

OVERVIEW ROOFING EXTERIOR STRUCTURE ELECTRICAL HEATING COOLING INSULATION PLUMBING INTERIOR

RECALCHEK OUR ADVICE APPENDIX REFERENCE

Description

Heat pump type:

• Ductless (Mini split) system

The ductless-mini-split heat-pumps provide cooling and supplemental heating in the areas they are installed.



Outdoor units x3



Fujitsu 2 - Outdoor unit



Fujitsu 1 - Outdoor unit



Daikin 3 - Outdoor unit

COOLING & HEAT PUMP


82 Salem Ave, Toronto, ON September 5, 2025

www.carsondunlop.com

OVERVIEW ROOFING EXTERIOR STRUCTURE ELECTRICAL HEATING COOLING INSULATION PLUMBING INTERIOR

RECALCHEK OUR ADVICE APPENDIX REFERENCE



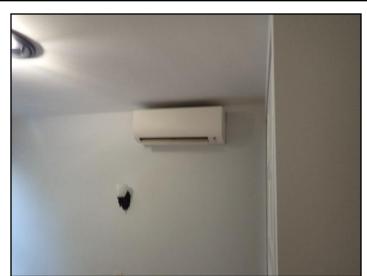

Main floor Indoor unit - Fujitsu

Indoor unit - Second floor rear - Daikin



Indoor unit - Second floor front - Fujitsu

Cooling capacity:

- 9,000 BTU/hr Daikin unit
- 12,000 BTU/hr Fujitsu units x2

Compressor approximate age:

- 10 years
- Not determined
- 2 Fujitsu units

Typical life expectancy: • 10 to 15 years

www.carsondunlop.com

82 Salem Ave, Toronto, ON September 5, 2025 ROOFING STRUCTURE ELECTRICAL COOLING INSULATION PLUMBING RECALCHEK OUR ADVICE APPENDIX REFERENCE

Observations and Recommendations

AIR CONDITIONING \ Life expectancy

Condition: • Air conditioner near the end of typical life expectancy

Although the air conditioning systems are close to the end of their life, continue to use and maintain the units until they

fail. Be prepared to replace at any time.

Task: Replace

Time: When necessary Cost: \$3,000 - \$6,000 each

Inspection Methods and Limitations

Inspection limited by: • Heat pumps are not operated in the heating mode when the outdoor temperature is above 70°F • Data plate not legible/accessible

INSULATION AND VENTILATION

Report No. 93897, v.2

www.carsondunlop.com

82 Salem Ave, Toronto, ON September 5, 2025 OVERVIEW ROOFING STRUCTURE ELECTRICAL COOLING INSULATION PLUMBING RECALCHEK APPENDIX OUR ADVICE REFERENCE

Description

Attic/roof insulation material: • Not visible

Attic/roof insulation amount/value: • Not visible

Attic/roof air/vapor barrier: • Not visible

Observations and Recommendations

RECOMMENDATIONS \ General

Condition: • For the most part, insulation details are not visible/accessible

In older houses, insulation levels (and ventilation) are usually below modern standards and, in many cases, it is not practical (or cost effective) to improve it unless the opportunity presents itself (e.g. during renovations).

Any upgrade would be considered a discretionary improvement (as opposed to a repair). Improvements may lead to lower heating/air conditioning costs and improved comfort.

Inspection Methods and Limitations

Inspection limited/prevented by lack of access to: • Attic

Inspection limited/prevented by lack of access to: • Wall space - access not gained

Roof ventilation system performance: • Not evaluated

PLUMBING

82 Salem Ave, Toronto, ON September 5, 2025

www.carsondunlop.com

OVERVIEW ROOFING EXTERIOR STRUCTURE ELECTRICAL HEATING COOLING INSULATION PLUMBING INTERIOR

RECALCHEK OUR ADVICE APPENDIX REFERENCE

Description

Service piping into building: • Copper

Supply piping in building: • Copper • PEX (cross-linked Polyethylene)

Main water shut off valve at the:

· Front of the basement





Front of the basement

Front of the basement

Water heater type:

• Integrated (combination) system Integrated combination boiler provides both heat and hot water. (see heating for details)

Pumps:

• Sump pump



Sump pump - Beside bathroom

PLUMBING

82 Salem Ave, Toronto, ON September 5, 2025

www.carsondunlop.com

OVERVIEW ROOFING EXTERIOR STRUCTURE ELECTRICAL HEATING COOLING INSULATION PLUMBING INTERIOR

RECALCHEK OUR ADVICE APPENDIX REFERENCE

• Sump pump

Below rear addition





Sump pump Sump pump

Floor drain location: • Center of basement

Observations and Recommendations

RECOMMENDATIONS \ General

Condition: • Many plumbing fixtures may be expected to last 15 years or more, although faucets are often replaced every 10 years.

WASTE PLUMBING \ Drain piping - performance

Condition: • The main sewer line to the street cannot be inspected during a home inspection. A video scan dramatically reduces the risk of expensive and unhealthy sewer back-ups.

Task: Provide after possession of the home

Cost: \$300 - \$600 is typical

WASTE PLUMBING \ Venting system

Condition: • Waste vent on exterior of home

This is not a typical installation, the risk is that condensation may freeze and block the vent however the likelihood of this is low.

The pipe is not well secured to the wall the strapping has come loose.

Location: Left side **Task**: Monitor / Secure

PLUMBING

82 Salem Ave, Toronto, ON September 5, 2025

www.carsondunlop.com

OVERVIEW ROOFING EXTERIOR STRUCTURE ELECTRICAL HEATING COOLING INSULATION PLUMBING INTERIOR

RECALCHEK OUR ADVICE APPENDIX REFERENCE



Waste vent stack



Waste vent stack

WASTE PLUMBING \ Sump pump

Condition: • Inoperative Location: Central

Task: Replace

Time: As soon as practical

Cost: \$150 and up



Inoperative

PLUMBING

September 5, 2025

www.carsondunlop.com

82 Salem Ave, Toronto, ON ROOFING STRUCTURE ELECTRICAL PLUMBING REFERENCE RECALCHEK OUR ADVICE APPENDIX

Inspection Methods and Limitations

Fixtures not tested/not in service:

• Shower

Basement bathroom floor had wet paint did not enter

Items excluded from a building inspection: • Tub/sink overflows

INTERIOR

82 Salem Ave, Toronto, ON September 5, 2025

www.carsondunlop.com

OVERVIEW ROOFING EXTERIOR STRUCTURE ELECTRICAL HEATING COOLING INSULATION PLUMBING INTERIOR

RECALCHEK OUR ADVICE APPENDIX REFERENCE

Description

General: • Interior finishes are in good repair overall.

Observations and Recommendations

CEILINGS AND WALLS \ General notes

Condition: • Typical minor flaws

FLOORS \ General notes

Condition: • Typical flaws

These cosmetic issues reflect normal wear and tear.

Location: Throughout

STAIRS \ Handrails and guards

Condition: • Missing **Location**: Basement

Task: Provide Time: If desired Cost: Minor

BASEMENT \ Leakage

Condition: • Almost every basement (and crawlspace) leaks under the right conditions. Based on a one-time visit, it's impossible to know how often or severe leaks may be. While we look for evidence of past leakage during ourconsultation, this is often not a good indicator of current conditions. Exterior conditions such as poorly performing gutters and downspouts, and ground sloping down toward the house often cause basement leakage problems. Please read Section 10.0 in the Interior section of the Home Reference Book before taking any action. You can find this in the Reference tab at the end of the report.

To summarize, wet basement issues can be addressed in 4 steps:

- 1. First, ensure gutters and downspouts carry roof run-off away from the home. (relatively low cost)
- 2. If problems persist, slope the ground (including walks, patios and driveways) to direct water away from the home. (Low cost if done by homeowner. Higher cost if done by contractor or if driveways, patios and expensive landscaping are disturbed.)
- 3. If the problem is not resolved and the foundation is poured concrete, seal any leaking cracks and form-tie holes from the inside. (A typical cost is \$300 to \$600 per crack or hole.)
- 4. As a last resort, dampproof the exterior of the foundation, provide a drainage membrane and add/repair perimeter drainage tile. (High cost)

INTERIOR

82 Salem Ave, Toronto, ON September 5, 2025

www.carsondunlop.com

OVERVIEW ROOFING EXTERIOR STRUCTURE ELECTRICAL HEATING COOLING INSULATION PLUMBING INTERIOR

RECALCHEK OUR ADVICE APPENDIX REFERENCE

Inspection Methods and Limitations

Inspection limited/prevented by: • New finishes/paint • Appliances inspections are limited scope, and some issues may not be identified.

Percent of interior foundation not visible: \bullet 80 %

RECALCHEK

82 Salem Ave, Toronto, ON September 5, 2025

www.carsondunlop.com

OVERVIEW	ROOFING	EXTERIOR	STRUCTURE	ELECTRICAL	HEATING	COOLING	INSULATION	PLUMBING	INTERIOR
RECALCHEK	OUR ADVICE	APPENDIX	REFERENCE						

Description

General: • We include a check for product recalls on major appliances at no extra cost. You will receive a separate report from RecallChek with any notices of product recalls and who to contact to get parts replaced, often free of charge. If there are recalls down the road, you will be notified. If you replace the equipment, just let RecallChek know and you will receive recall notices on these too.

Air Conditioner / Heat Pump:

Daikin



Daikin

Daikin



Daikin

RECALCHEK

82 Salem Ave, Toronto, ON September 5, 2025

www.carsondunlop.com

OVERVIEW ROOFING EXTERIOR STRUCTURE ELECTRICAL HEATING COOLING INSULATION PLUMBING INTERIOR

RECALCHEK OUR ADVICE APPENDIX REFERENCE

• Fujitsu



Fujitsu

• Fujitsu



Fujitsu

• Fujitsu

RECALCHEK

82 Salem Ave, Toronto, ON September 5, 2025

www.carsondunlop.com

OVERVIEW ROOFING EXTERIOR STRUCTURE ELECTRICAL HEATING COOLING INSULATION PLUMBING INTERIOR

RECALCHEK OUR ADVICE APPENDIX REFERENCE



Fujitsu

• Fujitsu



Fujitsu

Boiler:

Viessmann

RECALCHEK

82 Salem Ave, Toronto, ON September 5, 2025

www.carsondunlop.com

OVERVIEW ROOFING EXTERIOR STRUCTURE ELECTRICAL HEATING COOLING INSULATION PLUMBING INTERIOR

RECALCHEK OUR ADVICE APPENDIX REFERENCE



Viessmann

Refrigerator:

• Fisher & Paykel



Fisher & Paykel

Range:

Maytag

RECALCHEK

82 Salem Ave, Toronto, ON September 5, 2025

www.carsondunlop.com

OVERVIEW ROOFING EXTERIOR STRUCTURE ELECTRICAL HEATING COOLING INSULATION PLUMBING INTERIOR

RECALCHEK OUR ADVICE APPENDIX REFERENCE



Maytag

Dishwasher:

• Bosch



Bosch

RECALCHEK

82 Salem Ave, Toronto, ON September 5, 2025

www.carsondunlop.com

OVERVIEW ROOFING EXTERIOR STRUCTURE ELECTRICAL HEATING COOLING INSULATION PLUMBING INTERIOR

RECALCHEK OUR ADVICE APPENDIX REFERENCE

Inspection Methods and Limitations

Model number plate not found or not legible on: • Dryer • Washing machine

82 Salem Ave. Toronto. ON September 5, 2025

www.carsondunlop.com

	,	,							
OVERVIEW	ROOFING	EXTERIOR	STRUCTURE	ELECTRICAL	HEATING	COOLING	INSULATION	PLUMBING	INTERIOR
RECALCHEK	OUR ADVICE	APPENDIX	REFERENCE						

Description

OUR ADVICE FOR LOOKING AFTER YOUR HOME: • Home maintenance is an important responsibility. It protects your investment, extends life expectancy and helps avoid significant expenses. This document is an integral part of the report, and will help you avoid many common problems and reduce costs.

Priority Maintenance and Home Set-Up: • The Home Set-Up and Maintenance chapter in the Home Reference Book provides important information regarding things that are done once when moving in, as well as regular maintenance activities.

Please be sure to follow these maintenance guidelines. The Home Reference Book is included under the REFERENCE tab in this report.

Basement/Crawlspace Leakage: • Basement water leakage is the most common problem with homes. Almost every basement and crawlspace leaks under the right conditions. Good maintenance of exterior grading, gutters and downspouts is critically important.

For more details, please refer to Section 10 of the Interior chapter of the Home Reference Book, which is in the REFERENCE tab in this report.

Roof - Annual Maintenance: • It is important to set up an annual inspection and tune-up program to minimize the risk of leakage and maximize the life of the roof. Roof leaks may occur at any time and are most often at penetrations or changes in material. A leak does not necessarily mean the roof needs to be replaced.

Roof coverings are disposable and have to be replaced from time to time. Asphalt shingles, for example, last roughly 15 years.

Also, in a mature neighborhood with mature trees, gutters and downspouts can readily become clogged with leaves and debris. Seasonal maintenance and cleaning can help promote adequate drainage from the roof structure and help keep water away from the home and foundation.

Exterior - Annual Maintenance: • Annual inspection of the exterior is important to ensure weather-tightness and durability of exterior components. Grading around the home should slope to drain water away from the foundation to help keep the basement dry.

Painting and caulking should be well maintained. Particular attention should be paid to horizontal surfaces where water may collect.

Joints, intersections, penetrations and other places where water may enter the building assembly should be checked and maintained regularly.

The water supply for all hose bibbs should be shut off from the interior shut-off valve(s) provided and the line(s) drained each season before winter; to help prevent potential freezing of the water supply pipe(s) and subsequent possible flooding issues.

Garage Door Operators: • The auto reverse mechanism on your garage door opener should be tested monthly. The door should also reverse when it meets reasonable resistance, or if the 'photo eye' beam is broken.

OUR ADVICE

82 Salem Ave, Toronto, ON September 5, 2025

www.carsondunlop.com

o_ oa.o vo, ro.oo, o.v. oop.oo. o, _o_										
	OVERVIEW	ROOFING	EXTERIOR	STRUCTURE	ELECTRICAL	HEATING	COOLING	INSULATION	PLUMBING	INTERIOR
	RECALCHEK	OUR ADVICE	APPENDIX	REFERENCE						

Electrical System - Label the Panel: • Each circuit in the electrical panel should be labelled to indicate what it controls. This improves both safety and convenience. Where the panel is already labelled, the labelling should be verified as correct. Do not rely on existing labeling.

Ground Fault Circuit Interrupters and Arc Fault Circuit Interrupters: • These should be tested monthly using the test buttons on the receptacles or on the breakers in the electrical panel.

Heating and Cooling System - Annual Maintenance: • Set up an annual maintenance agreement that covers parts and labour for all heating and cooling equipment. This includes gas fireplaces and heaters, as well as furnaces, boilers and air conditioners. Include humidifiers and electronic air cleaners in the service agreement. Arrange the first visit as soon as possible after taking possession.

Check filters for furnaces and air conditioners monthly and change or clean as needed. Duct systems have to be balanced to maximize comfort and efficiency, and to minimize operating costs. Adjust the balancing for heating and cooling seasons, respectively.

For hot water systems, balancing should be done by a specialist due to the risk of leakage at radiator valves. These valves are not operated during a home inspection.

Bathtub and Shower Maintenance: • Caulking and grout in bathtubs and showers should be checked every 6 months, and improved as necessary to prevent leakage and water damage behind walls and below floors.

Water Heaters: • All water heaters should be flushed by a specialist every year to maximize performance and life expectancy. This is even more critical on tankless water heaters.

Washing Machine Hoses: • We suggest braided steel hoses rather than rubber hoses for connecting washing machines to supply piping in the home. A ruptured hose can result in serious water damage in a short time, especially if the laundry area is in or above a finished part of the home.

Clothes Dryer Vents: • We recommend that vents for clothes dryers discharge outside the home. The vent material should be smooth walled (not corrugated) metal, and the run should be as short and straight as practical. This reduces energy consumption and cost, as well as drying time for clothes. It also minimizes the risk of a lint fire inside the vent.

Lint filters in the dryer should be cleaned every time the dryer is used. There is a secondary lint trap in many condominiums. These should be cleaned regularly. There may also be a duct fan controlled by a wall switch. The fan should

be ON whenever the dryer is used.

Dryer ducts should be inspected annually and cleaned as necessary to help reduce the risk of a fire, improve energy efficiency and reduce drying times.

Fireplace and Wood Stove Maintenance: • Wood burning appliances and chimneys should be inspected and cleaned before you use them, and annually thereafter. We recommend that specialists with a WETT (Wood Energy Technology Transfer, Inc.) designation perform this work. Many insurance companies require a WETT inspection for a property with a wood burning device.

Smoke and Carbon Monoxide (CO) Detectors/Alarms: • Smoke detectors are required at every floor level of every home, including basements and crawlspaces. Even if these are present when you move into the home, we recommend replacing the detectors. We strongly recommend photoelectric smoke detectors rather than ionization type detectors. Carbon monoxide detectors should be provided adjacent to all sleeping areas.

OUR ADVICE

82 Salem Ave, Toronto, ON September 5, 2025

www.carsondunlop.com

OVERVIEW	ROOFING	EXTERIOR	STRUCTURE	ELECTRICAL	HEATING	COOLING	INSULATION	PLUMBING	INTERIOR
RECALCHEK	OUR ADVICE	APPENDIX	REFERENCE						

These devices are not tested during a home inspection. Detectors should be tested every 6 months, and replaced every 10 years. Batteries for smoke and carbon monoxide detectors should be replaced annually. If unsure of the age of a smoke detector, it should be replaced.

Backwater Valve: • A backwater valve protects your home from a backup of the municipal sewer system. The valve may be equipped with an alarm to notify you of a backup. Please note: if the valve is closed due to a municipal sewer backup, you cannot use the plumbing fixtures in the home. The waste water is unable to leave the building and will back up through floor drains and the lowest plumbing fixtures. • The valve should be inspected and cleaned as necessary at least twice a year.

Sump Pump: • A sump pump collects storm water below the basement floor and discharges it safely to the exterior to prevent flooding. The discharge point should be at least 6 feet (2 m) away from the home. Best installations include backup power for the sump pump, so it will work in the event of a power outage. A high water alarm in the sump pump will notify you if the pump fails. Some installations include a backup pump.

The sump and pump should be inspected and tested four times a year.

For condominium owners: • Condominium owners - Maintenance and Repairs: There are two types of repairs that may be performed in a condo - repairs to an individual condo unit and repairs to common elements. Common elements are set out in the Condominium Declaration and will differ from one building to another. If repairs must be made inside your unit, you are responsible for making the repairs at your own expense. You are also responsible for the ongoing maintenance of your unit. The condominium corporation's board of directors is responsible for maintenance and repair of the common elements. Exclusive-use common elements, such as parking spaces or balconies are generally maintained by the condominium board.

Be Ready for Emergencies: Be sure you know where to shut off the water. Some condos have more than one shut off, and others need a special tool (key) to turn off water. Label each circuit on the electrical panel, and make sure you should know how to turn off the power. Keep a fire extinguisher suitable for grease fires near the kitchen.

Property Manager and Concierge/Security: Keep the contact information for these folks handy (perhaps on your phone) wherever you are. • Lint filters in the dryer should be cleaned every time the dryer is used. There is a secondary lint trap in many condominiums. These should be cleaned regularly. There may also a duct fan controlled by a wall switch. The fan should be ON whenever the dryer is used.

END OF REPORT

82 Salem Ave, Toronto, ON September 5, 2025

STRUCTURE COOLING INSULATION ROOFING PLUMBING OUR ADVICE **APPENDIX**

Investments. Insurance. Advice. All in one place.

For more than 75 years, we've been helping Canadians, like you, build financial security. Whether you're looking for investments, insurance or both, count on us for the personalized advice and solutions you need to keep what matters safe and save for what matters. Let us help you with:



Investments

Choose from straightforward saving and investing options to help you achieve financial success, however you define it.



Design a plan that protects what you've worked so hard to build. And access unique services that help your business grow.

www.carsondunlop.com



Life

Protect your loved ones, your assets and your financial future, with the right type and amount



Secure your property and your livelihood, with a plan that accounts for the specifics of your farming operation.



Home

Keep your living space and everything within it safe, with a customized policy for your home, condominium or cottage.



Travel*

Enjoy affordable coverage, whether you're travelling for work or play, and whether it's a short visit or an extended stay.



Auto

Get coverage that factors in what you drive, when you drive, and discounts for a clean driving record. Add a policy for greater savings!



Group Benefits

Up your competitive edge, with a plan that supports the health and well-being of your most important asset: your employees.

Ready to build your financial future?

Talk to us about creating a plan that meets your needs for today and your goals for tomorrow.

RJB Insurance Group Inc.

30-1029 King Street West, Toronto 416-264-2281 rjb_insurance@cooperators.ca

Vel Insurance Services Inc.

708-10 Milner Business Court, Toronto 416-396-0707 vel_insurance@cooperators.ca

Investments. Insurance. Advice.



Co-operators Financial Investment Services Inc.

vel offered is both inbound and outbound travel and is administered by Allianz Global Assistance.

Mutual funds are offered through Co-operators Financial Imensatives Inc. to Canadian residents except those in Ouebec and the territories. Life products and Group Benefits plans are underwritten by Co-operators Life Insurance Company, Home, Auto, Commercial and Farm insurance is underwritten by Co-operators General Insurance Company, Not all products are available in all provinces. Please refer to your policy for applicable coverage limitations and exclusions. Co-operators General Insurance Company, Co-operators Life Insurance Company, Act Co-operators Financial Immesterned Services are accommitted by protecting the privacy confidentiality. Account of security of the processing of the privacy confidentiality. Account of security of the processing the privacy confidentiality accounts of security of the processing the privacy confidentiality. Accounts of the confidentiality accounts of conducting our business. Please with two cooperators Carbon Public Pages Privacy accounts from the Co-operators fundamental to the Co-operators Group Limited Efficiency.

82 Salem Ave, Toronto, ON

OVERVIEW ROOFING EXTERIOR STRUCTURE ELECTRICAL HEATING COOLING INSULATION PLUMBING INTERIOR RECALCHEK OUR ADVICE APPENDIX REFERENCE



As a Carson Dunlop client, you are entitled to many useful discounts and perks from some of our home service partners.



Woodbridge GTA ClimateCare (\$160 value)

- •Get a **FREE** safety inspection and tune-up on your home's heating or cooling systems (your choice)
- •Claim your \$160 value tune-up by calling <u>905-851-7007</u> or emailing <u>info@gtaclimatecare.com</u>



\$70 gift card from 1-800-GOT-JUNK?

Carson Dunlop clients receive a \$70 gift card for junk removal services.

82 Salem Ave, Toronto, ON September 5, 2025

OVERVIEW ROOFING EXTERIOR STRUCTURE ELECTRICAL HEATING COOLING INSULATION PLUMBING INTERIOR


RECALCHEK OUR ADVICE APPENDIX REFERENCE




THREE STEPS TO COST-EFFECTIVE HOME FLOOD PROTECTION

Complete these 3 steps to reduce your risk of flooding and lower the cost of cleanup if flooding occurs. For items listed under step 3 check with your municipality about any permit requirements and the availability of flood protection subsidies. *Applicable only in homes with basements


Step 1: Maintain What You've Got at Least Twice per Year

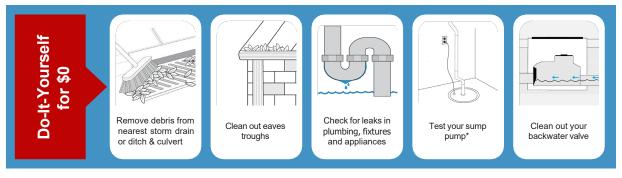

Step 2: Complete Simple Upgrades

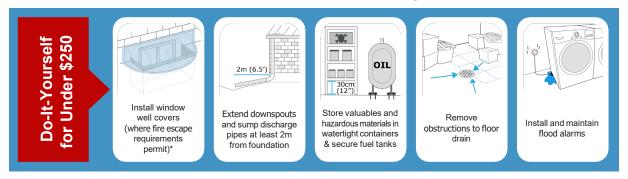

Step 3: Complete More Complex Upgrades

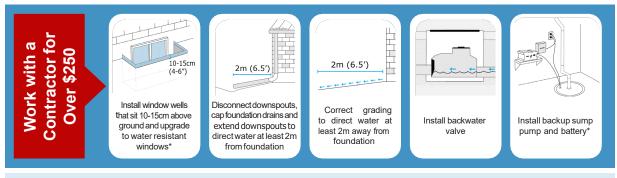

Note: Not all actions will be applicable to each home. Completing these steps does not guarantee the prevention of flooding.



For Additional Resources Visit:





www.carsondunlop.com

82 Salem Ave, Toronto, ON September 5, 2025 www.carsondunlop.com

ROOFING STRUCTURE PLUMBING RECALCHEK REFERENCE OUR ADVICE **APPENDIX**



Basement Flood Protection Checklist

Take these steps to reduce your risk of basement flooding and reduce the cost of cleaning up after a flood. Remember to check with your municipality about the availability of basement flood protection subsidies. Check with your insurer about discounts for taking action to reduce flood risk.

SPRING FALL	Remove debris from nearest storm drain Clean out eaves troughs Test sump pump(s) and backup power source Clean out backwater valve Maintain plumbing, appliances and fixtures Test flood alarms
	2. Keep Water Out of Your Basement
	Correct grading to direct water at least 2m away from your foundation Extend downspouts and sump discharge pipes to direct water at least 2m away from your foundation or to the nearest drainage swale Install window well covers Install window wells that are 10-15cm above the ground and are sealed at the foundation Install water-resistant basement windows Install a backwater valve (work with a plumber and get required permits)
	3. Prepare to Remove Any Water from Your Basement as Quickly as Possible Remove obstructions to the basement floor drain Install a back-up sump pump and power source
	4. Protect Personal Belongings in Your Basement
	Store valuables in watertight containers or remove Store hazardous materials (paints, chemicals) in watertight containers or remove Raise electronics off the floor Select removable area rugs and furnishings that have wooden or metal legs
Note: Not all	actions will be applicable to each home. Completing these steps does not guarantee the prevention of basement flooding.
	CENTRE For Additional Resources Visit: UNIVERSITY OF

INIACI CENIKE ON CLIMATE ADAPTATION

www.HomeFloodProtect.ca



APPENDIX

82 Salem Ave, Toronto, ON September 5, 2025

www.carsondunlop.com

OVERVIEW ROOFING EXTERIOR STRUCTURE ELECTRICAL HEATING COOLING INSULATION PLUMBING INTERIOR

RECALCHEK OUR ADVICE APPENDIX REFERENCE

THIS CONTRACT LIMITS THE LIABILITY OF THE HOME INSPECTOR AND THE HOME INSPECTION COMPANY.

PLEASE READ CAREFULLY BEFORE ACCEPTING.

The term "Inspector" or "we" as used in this document means, collectively, the home inspector and Carson, Dunlop & Associates Ltd. ("CD"), the home inspection company. The home inspection ("Inspection") is performed in accordance with the Standards of Practice of the Canadian Association of Home and Property Inspectors (the "Standards"). We recommend that you review the Standards before agreeing to the Inspection. To access the Standards, click CAHPI 2023 National Standards of Practice.

1) PURPOSE AND LIMITATIONS

The Inspector's report (the "Report") is an opinion of the present condition of the property based on a visual examination of the readily accessible features of the building.

An Inspector is a generalist, rather than a specialist. The Inspection is a non-invasive performance review, rather than a design review. The Inspector does not perform calculations to determine whether mechanical, electrical, and structural systems, for example, are properly sized. The Inspector will not perform any engineering, architectural, plumbing or electrical services or assessments that require an occupational license.

The Inspector may report on deficiencies or conditions that are normally outside the scope of the Inspection, but this is done as a courtesy and does not change the scope of the Inspection.

If the purpose or limitations are not clear, we encourage you to contact the Inspector to discuss the agreement before accepting and before the inspection.

2) THE INSPECTION IS NOT TECHNICALLY EXHAUSTIVE

The Inspection is a sampling exercise and is not technically exhaustive. While looking for major issues, we typically come across some smaller issues. These may be included in the Report as a courtesy, but not all issues will be identified. Cosmetic and other non-critical items are not part of the Inspection. Establishing the significance of an issue may be beyond the scope of the Inspection. Further evaluation by a specialist may be required at additional cost.

A Technical Audit is a more in-depth, technically exhaustive inspection of the home that provides more information than an Inspection. We have both services available. By accepting and signing this Agreement, you acknowledge that you have chosen an Inspection instead of a Technical Audit.

If you are concerned about any conditions noted in the Report, we strongly recommend that you consult a qualified specialist for a more detailed analysis.

3) THE INSPECTION IS AN OPINION OF THE PRESENT CONDITION OF THE VISIBLE COMPONENTS

The Report is based on the visually observable conditions on the date and time of the Inspection. Not all deficiencies may be apparent due to weather conditions, inoperable systems, inaccessibility, etc. The Inspector cannot predict future conditions.

APPENDIX

82 Salem Ave, Toronto, ON September 5, 2025

www.carsondunlop.com

OVERVIEW ROOFING EXTERIOR STRUCTURE ELECTRICAL HEATING COOLING INSULATION PLUMBING INTERIOR

RECALCHEK OUR ADVICE APPENDIX REFERENCE

An Inspection does NOT include or identify defects that are hidden behind walls, floors, ceilings, storage, furniture, etc. This includes inaccessible elements such as, but not limited to, wiring, heating, cooling, structure, plumbing and insulation. Inspectors do not remove wall coverings (including wallpaper), lift flooring (including carpet), or move storage or furniture.

Intermittent problems may not be visible on an Inspection because they only happen under certain circumstances. For example, the Inspector may not discover leaks that occur only during certain weather conditions.

Representative sampling is used for components where there are several similar items. This includes, but is not limited to, roofing, siding, masonry, caulking, windows, interior doors, electrical wiring, receptacles, switches, ducts and pipes, insulation and air/vapor barriers, and floor, wall, and ceiling surfaces.

4) THIS IS NOT A CODE-COMPLIANCE INSPECTION

Inspectors do NOT determine whether the property complies with past or present building codes, electrical codes, fuel codes, fire codes, regulations, laws, by-laws, ordinances, or other regulatory requirements. Codes change regularly, and most homes do not comply with current codes.

5) THE INSPECTION DOES NOT INCLUDE HAZARDOUS MATERIALS

The Inspection does NOT address building materials that are suspected of posing a risk to health such as phenol-formaldehyde and urea-formaldehyde based insulation, fiberglass insulation and vermiculite insulation. Inspectors do NOT identify asbestos in roofing, siding, wall, ceiling or floor finishes, insulation, fireproofing, etc. Inspectors do NOT look for lead or other toxic metals. Environmental consultants should be consulted independently, at additional cost, should concerns exist.

The Inspection does not address environmental hazards such as the past use of insecticides, fungicides, herbicides, pesticides or termite treatments.

6) THE INSPECTION DOES NOT ADDRESS MOULD AND THE AIR QUALITY IN A BUILDING

The Inspection does NOT address irritants, pollutants, contaminants, or toxic materials in or around the building. This includes, for example, spores, fungus, mould, or mildew.

You should note that whenever there is water damage, there is a possibility that mould or mildew may be present, unseen behind a wall, floor, or ceiling.

If anyone in your home suffers from allergies or heightened sensitivity to quality of air, or if there are water penetration issues noted in the Report, we strongly recommend that you consult a qualified environmental consultant who can test for toxic materials, mould and allergens at an additional cost.

7) THE INSPECTION DOES NOT INCLUDE BURIED TANKS

Inspectors do NOT look for, and are not responsible for identifying, fuel oil, septic or gasoline tanks that may be buried on the property. If there are fuel oil or other storage tanks on the property, you may be responsible for their removal and the safe disposal of any contaminated soil. If you suspect there is a buried tank, we strongly recommend that you retain a qualified Environmental Consultant, at an additional cost, to investigate further.

APPENDIX

82 Salem Ave. Toronto. ON September 5, 2025

www.carsondunlop.com

on outside the control of the contro									
OVERVIEW	ROOFING	EXTERIOR	STRUCTURE	ELECTRICAL	HEATING	COOLING	INSULATION	PLUMBING	INTERIOR
RECALCHEK	OUR ADVICE	APPENDIX	REFERENCE						

8) CANCELLATION FEE

If the Inspection is cancelled within 24 hours of the appointment time, a cancellation fee of 50% of the fee will apply.

9) THERMAL IMAGING (If included with this Inspection)

The use of a thermal imager by your Inspector (which you can purchase for an extra cost) is for the purpose of screening for potential water issues. While the use of this equipment improves the odds of detecting a moisture issue, it is not a guarantee, as numerous conditions can mask the thermal signature of moisture. Thermal imaging will not detect all moisture issues behind walls, ceilings, or furniture. Additionally, water leakage is often intermittent, and cannot be detected when not present.

10) MOULD ASSESSMENT (If included with this Inspection)

The services provided in this optional assessment (which you can purchase for an extra cost) include a visual inspection for signs of water intrusion and mould growth. Moisture readings will be collected. Two indoor air samples and one outdoor reference sample will be collected. Should visible mould growth be identified, one surface sample will be collected. The results of the sample and investigation will be summarized in a written Report.

The mould assessment will not be able to detect or identify all mould that may be present in the home, including that which is hidden behind walls, floors, ceilings, storage, or furniture.

11) REPORT IS FOR OUR CLIENT ONLY

The Report is for the exclusive use of the client named herein and their real estate agent if applicable and will not be released to others without the client's consent. No use of, or reliance on, the Report or any information contained in the Report by any other party is intended. The client agrees that the Report will not be shared or distributed to third parties, except to prospective buyers of the property in the case of a pre-listing inspection.

NOTE: If you do not want your real estate agent to receive a copy of the report, please let us know at 416-964-9415 or inspection@carsondunlop.com.

12) NOT A GUARANTEE, WARRANTY, OR INSURANCE POLICY

The Inspection and Report are NOT a guarantee, warranty, or an insurance policy on the condition, future use, operability, habitability or suitability of the home or its components.

Given the limitations to the visual Inspection, the Inspector is neither responsible nor liable for the nondiscovery of any patent or latent defects, or other conditions which may occur or may become evident after the date and time of the Inspection.

13) TIME TO INVESTIGATE

The Inspector will have no liability for any claim or complaint if conditions have been disturbed, altered, repaired, replaced, or otherwise changed before the Inspector has had reasonable time to investigate.

APPENDIX

82 Salem Ave, Toronto, ON September 5, 2025

www.carsondunlop.com

OVERVIEW ROOFING EXTERIOR STRUCTURE ELECTRICAL HEATING COOLING INSULATION PLUMBING INTERIOR

RECALCHEK OUR ADVICE APPENDIX REFERENCE

14) LIMIT OF LIABILITY/INDEMNITY

By executing this Agreement, you expressly agree that the TOTAL CUMULATIVE LIABILITY OF THE INSPECTOR AND CD FOR ANY DAMAGES ARISING OUT OF ANY ACTS OR OMISSIONS WITH RESPECT TO THE INSPECTOR'S INSPECTION AND REPORT, FOR ANY CAUSE OF ACTION WHATSOEVER, WHETHER IN CONTRACT OR TORT (INCLUDING NEGLIGENCE), IS LIMITED TO A REFUND OF THE FEES THAT YOU HAVE BEEN CHARGED FOR THIS INSPECTION OR \$1,000, WHICHEVER IS GREATER.

You agree to indemnify and hold the Inspector, CD and its directors, officers, employees, agents, affiliates and consultants harmless from and against any and all claims, demands, liabilities, judgements, losses and expenses, including legal fees and expenses, brought against or involving the Inspector that relate to or arise out of the Inspection or the Report whether indirect, consequential, punitive or special losses, damages, or loss of profits.

You agree that any claim for negligence, breach of contract or otherwise relating to the Inspection or the Report will be made in writing and reported to the Inspector within 10 business days of discovery. Further, you agree to allow the Inspector the opportunity to re-inspect the claimed discrepancy, except for an emergency condition, before anyone repairs, replaces, alters or modifies the claimed discrepancy. You understand and agree that any failure to notify the Inspector as stated above shall constitute a waiver of all claims that you may have against the Inspector.

This limit of liability clause may be altered at the discretion and agreement of the Inspector and the client, but any agreement must be in writing and appended to this Agreement.

15) TIME PERIOD

You acknowledge and agree that the timeframe for commencement of legal proceedings by you against the Inspector for damages suffered by you as a result of alleged errors, omissions, breaches of contract and/or negligence by the Inspector shall not be later than one (1) year from the date of the Inspection.

16) PRIVACY/USE OF PERSONAL INFORMATION

The Inspector confirms their commitment to collect, store and use your personal information only in accordance with the terms of the CD's Privacy Policy. A copy of this document may be accessed at https://www.carsondunlop.com/privacy/. You are strongly encouraged to review this document before signing this Agreement and providing your personal information to the Inspector and CD.

The Inspector may collect data which will primarily consist of information relating to the visual inspection conducted, but may also consist of other data relating to the property inspected, client and/or client representative personal and contact information, and demographic data. The Inspector may use the collected data to perform analysis, improve business processes, improve the CD inspection experience, and obtain feedback from clients and client representatives. The Inspector confirms that collection and use of this data and certain personal information is for the following purposes:

To provide you with information regarding CD products, services and benefits that you request
or other products, services and benefits which may interest you; and

APPENDIX

82 Salem Ave, Toronto, ON September 5, 2025

www.carsondunlop.com

OVERVIEW	ROOFING	EXTERIOR	STRUCTURE	ELECTRICAL	HEATING	COOLING	INSULATION	PLUMBING	INTERIOR
RECALCHEK	OUR ADVICE	APPENDIX	REFERENCE						

To identify trends and patterns related to the use of goods and services in the home inspection
and construction industries and to provide information on those trends and patterns to our
customers and others.

In addition, the Inspector may provide collected data to third-party service providers ("TPSPs") to offer value-added services to clients, as described in this Agreement. The Inspector may provide aggregated collected data, individual collected data and/or collected personal information (including name, property address, email addresses, phone numbers, appliance information and property data) to third parties. Other than interaction with TPSPs, aggregated data, individual collected data and/or collected personal information, the Inspector will not sell or rent the collected data to anyone, or share the collected data with any third party except as necessary to fulfill client requests.

By executing this Agreement, you confirm that you expressly consent to the collection and use of data by the Inspector as described herein and in CD's Privacy Policy.

If you DO NOT consent to the Inspector providing collected data to TPSPs for the purpose described herein, you may opt-out by emailing privacy@carsondunlop.com.

If you DO NOT consent to receiving future communications from CD concerning its products and services, you may opt-out by emailing privacy@carsondunlop.com.

17) LEGAL ADVICE

You acknowledge that you have either sought and received, or have had sufficient opportunity to seek and receive, such independent legal advice as you desire in relation to the effect of this Agreement and your legal rights.

18) CLIENT'S AGREEMENT

You understand and agree to be bound by each provision of this Agreement. You hereby confirm that you have the authority to bind any other family members or other interested parties to this Agreement.

If any court declares any provision of this Agreement invalid or unenforceable, the remaining provisions will remain in effect. This Agreement represents the entire agreement between the parties. All prior communications are merged into this Agreement, and there are no terms or conditions other than those set forth herein. No statement or promise of the Inspector shall be binding unless reduced to writing and signed by the Inspector. No change or modification shall be enforceable against any party unless such change or modification is in writing and signed by the parties.

www.carsondunlop.com

OVERVIEW ROOFING EXTERIOR STRUCTURE ELECTRICAL HEATING COOLING INSULATION PLUMBING INTERIOR

RECALCHEK OUR ADVICE APPENDIX REFERENCE



Canadian Association of Home & Property Inspectors

2023 National Standards of Practice

The National Standards of Practice are for home and property inspectors to follow in the performance of their inspections. They are the most widely accepted Canadian home and property inspection Standards in use and address all the home's major systems and components as listed in this Standard. The National Standards of Practice and Code of Ethics are recognized by many related professionals as the definitive standards for professional performance in the industry.

These National Standards of Practice are being published to inform the public on the nature and scope of visual building inspections performed by home and property inspectors who are members of the Canadian Association of Home & Property Inspectors (CAHPI).

The purpose of the National Standards of Practice is to provide minimum requirements for home and property inspectors regarding both the inspection itself and the inspection report, and to define certain terms relating to the performance of home or property inspections to ensure consistent interpretation.

These standards take into account that a visual inspection of a building does not constitute an evaluation or a verification of compliance with building codes, standards or regulations governing the construction industry or the health and safety industry, or standards and regulations governing insurability.

INDEX									
1.	Introduction	2							
2.	Purpose and Scope	2							
3.	General Limitations and Exclusions	2							
4.	Structural Systems	4							
5.	Exterior Systems	4							
6.	Roof Systems	4							
7.	Plumbing Systems	4							
8.	Electrical Systems	4							
9.	Heating Systems	5							
10.	Fireplaces & Solid Fuel Burning Appliances	5							
11.	Air Conditioning Systems	5							
12.	Interior Systems	5							
13.	Insulation and Vapour Retarders	5							
14.	Mechanical and Natural Ventilation Systems	6							
	Glossary	6							

Any terms not defined in the glossary of this standard will use industry standard terms

Glossary Note: Italicized words are defined in the Glossary.

 $2023 \ National \ Standards \ of \ Practice. \ @ \ Copyright \ 2023 \ Canadian \ Association \ of \ Home \ \& \ Property \ Inspectors. \ All \ Rights \ Reserved.$

APPENDIX

82 Salem Ave, Toronto, ON September 5, 2025

www.carsondunlop.com

OVERVIEW	ROOFING	EXTERIOR	STRUCTURE	ELECTRICAL	HEATING	COOLING	INSULATION	PLUMBING	INTERIOR
RECALCHEK	OUR ADVICE	APPENDIX	REFERENCE						

1. INTRODUCTION

1.1 The Canadian Association of Home & Property Inspectors (CAHPI) is a not-for-profit association. CAHPI strives to promote excellence within the profession and continual improvement of inspection services to the public.

2. PURPOSE AND SCOPE

2.1 The purpose of these National Standards of Practice is to establish professional and uniform Standards for home and property inspectors who are members of CAHPI. Home and Property Inspections performed to these National Standards of Practice are intended to provide information regarding the condition of the systems and components of the building as observed at the time of the Inspection.

These National Standards of Practice apply to inspections of part or all of a building for the following building types:

- single-family dwelling, detached, semi-detached or row house
- · multi-unit residential building
- residential building held in divided or undivided co-ownership
- residential building occupied in part for a residential occupancy and in part for a commercial occupancy, as long as the latter use does not exceed 40% of the building's total area, excluding the basement.

2.2 THE INSPECTOR SHALL:

A. inspect:

 readily-accessible, visually-observable installed systems, and components of buildings listed in these National Standards of Practice.

B. report:

- 1. on those installed *systems* and *components* that, in the professional opinion or judgement of the *inspector*, have a *significant deficiency*, or are near the end of their *service lives*.
- 2. the implication for the system or component that has a significant deficiency or is near the end of its service life.
- 3. the inspector's recommendations to correct, repair, or refer for further evaluation of the reported deficiency by a qualified specialist.
- 4. on any *systems* and *components* designated for inspection in these National Standards of Practice which were known to be present at the time of the *Home or Property Inspection* but were not inspected and a reason they were not inspected.

2.3 These National Standards of Practice are not intended to limit inspectors from:

- A. including other inspection services in addition to those required by these National Standards of Practice provided the *inspector* is appropriately qualified to do so.
- B. excluding systems and components from the inspection if requested by the client or as dictated by circumstances at the time of the inspection.

3. GENERAL LIMITATIONS AND EXCLUSIONS

3.1 GENERAL LIMITATIONS:

- A. Inspections performed in accordance with these National Standards of Practice
 - 1. are not technically exhaustive.
 - 2. will not identify concealed conditions or latent defects.

3.2 GENERAL EXCLUSIONS:

A. The *inspector* is not required to perform any action or make any determination unless specifically stated in these National Standards of Practice, except as may be required by lawful authority.

APPENDIX

82 Salem Ave, Toronto, ON September 5, 2025

www.carsondunlop.com

OVERVIEW	ROOFING	EXTERIOR	STRUCTURE	ELECTRICAL	HEATING	COOLING	INSULATION	PLUMBING	INTERIOR
RECALCHEK	OUR ADVICE	APPENDIX	REFERENCE						

B. Inspectors are NOT required to determine:

- 1. condition of systems or components which are not readily accessible.
- 2. remaining service life of any system or component.
- 3. strength, adequacy, effectiveness, or efficiency of any system or component.
- 4. causes of any condition or deficiency.
- 5. methods, materials, or costs of corrections.
- 6. future conditions including, but not limited to, failure of systems and components.
- 7. suitability of the property for any use.
- 8. compliance with regulatory requirements (codes, regulations, laws, ordinances, etc.).
- 9. market value of the property or its marketability.
- 10. advisability of the purchase of the property.
- 11. presence of potentially hazardous plants, animals or insects including, but not limited to wood destroying organisms, diseases or organisms harmful to humans.
- 12. presence of any environmental hazards including, but not limited to toxins, carcinogens, noise, and contaminants in soil, water, and air.
- effectiveness of any system installed or methods utilized to control or remove suspected hazardous substances.
- 14. operating costs of systems or components.
- 15. acoustical properties of any system or component.
- 16. design adequacy with regards to location of the home or property, or the elements to which it is exposed.

C. Inspectors are NOT required to offer or perform:

- 1. any act or service contrary to law, statute or regulation.
- 2. engineering, architectural and technical services.
- 3. work in any trade or any professional service other than home or property inspection.
- 4. warranties or guarantees of any kind.

D. Inspectors are NOT required to operate:

- 1. any system or component which is shut down or otherwise inoperable.
- 2. any system or component which does not respond to normal operating controls.
- 3. shut-off valves.

E. Inspectors are NOT required to enter:

- 1. any area which will, in the opinion of the *inspector*, likely be hazardous to the *inspector* or other persons or damage the property or its *systems* or *components*.
- 2. spaces which are not readily accessible.

F. Inspectors are NOT required to inspect:

- underground items including, but not limited to, storage tanks or other indications of their presence, whether abandoned or active.
- 2. systems or components which are not installed.
- 3. decorative items.
- 4. systems or components located in areas that are not readily accessible in accordance with these National Standards of Practice.
- 5. detached buildings.
- 6. common elements or common areas in multi-unit housing, such as condominium/strata properties, or cooperative housing when inspecting individual units, including the roof and building envelope.
- 7. test and/or operate any fire alarm system, burglar alarm system, automatic sprinkler system or other fire protection equipment, electronic or automated installations, telephone, intercom, cable/ internet systems and any lifting equipment, elevator, freight elevator, wheelchair lift, climbing chair, escalator or others:
- 8. pools, spas and their associated safety devices.

G. Inspectors are NOT required to:

- 1. perform any procedure or operation which will, in the opinion of the *inspector*, likely be hazardous to the *inspector* or other persons or damage the property or its *systems* or *components*.
- 2. move suspended ceiling tiles, personal property, furniture, equipment, plants, soil, snow, ice, or debris.
- 3. dismantle any system or component.

OVERVIEW ROOFING EXTERIOR STRUCTURE ELECTRICAL HEATING COOLING INSULATION PLUMBING INTERIOR

RECALCHEK OUR ADVICE APPENDIX REFERENCE

4. STRUCTURAL SYSTEMS

4.1 THE INSPECTOR SHALL:

A. inspect:

 structural components including visible foundation and framing.

B. report:

- 1. methods used to inspect the crawl space.
- 2. methods used to *inspect* the attics.

5. EXTERIOR SYSTEMS

5.1 THE INSPECTOR SHALL:

A. inspect:

- 1. exterior wall coverings, flashing and trim.
- 2. all exterior doors.
- 3. decks, balconies, stairs, porches, and their associated guards and handrails.
- 4. eaves, soffits, and fascia where visible from the ground level.
- 5. grading, and surface drainage.
- 6. walkways, patios, and driveways.
- 7. retaining walls and fences.
- 8. attached garages or carports including garage doors and garage door operators.

B. report:

1. the methods used to inspect the exterior walls and their related components.

5.2 THE INSPECTOR IS NOT REQUIRED TO:

A. inspect:

- screening, shutters, awnings, and similar accessories.
- 2. geological, geotechnical, or hydrological conditions.
- ${\it 3. recreational facilities.}$
- 4. detached garages and outbuildings except as required by local authority with jurisdiction.
- 5. mechanical lifts.
- 6. seawalls, breakwaters, dikes, and docks.
- 7. erosion control and earth stabilization measures.

6. ROOF SYSTEMS

6.1 THE INSPECTOR SHALL:

A. inspect:

- 1. roof coverings.
- 2. roof drainage systems.
- 3. flashings.
- 4. skylights, chimneys, and roof penetrations.

B. describe:

1. roof coverings.

C. report:

1. methods used to inspect the roofs.

6.2 THE INSPECTOR IS NOT REQUIRED TO:

www.carsondunlop.com

A. inspect:

- 1. antennae and satellite dishes.
- 2. interiors of flues or chimneys.
- 3. other *installed* items attached to but not related to the roof systems.

7. PLUMBING SYSTEMS

7.1 THE INSPECTOR SHALL:

A. inspect:

- 1. interior water supply and distribution *systems* including all fixtures and faucets.
- drain, waste and vent systems including all fixtures.
- water-heating equipment and associated venting systems.
- fuel storage and distribution systems.
- 5. drainage sumps, sump pumps, and related piping.
- 6. backflow preventers on supply piping.

B. describe:

- 1. water supply, distribution, drain, waste, and vent piping materials.
- water heating equipment including the energy source.
- 3. location of main water and fuel shut-off valves.

7.2 THE INSPECTOR IS NOT REQUIRED TO:

A. inspect:

- 1. clothes washing machine connections.
- 2. wells, well pumps, cisterns, or water storage related equipment.
- 3. water conditioning systems.
- 4. solar water heating systems.
- 5. fire sprinkler systems.
- $6.\ private\ waste\ disposal\ systems.$
- 7. irrigation systems.

B. determine:

- 1. whether water supply and waste disposal *systems* are public or private.
- 2. the quantity or quality of the water supply.

C. operate:

1. safety valves or shut-off valves.

8. ELECTRICAL SYSTEMS

8.1 THE INSPECTOR SHALL:

A. inspect:

- service drop.
- 2. service entrance conductors, cables, and raceways.
- 3. service equipment and main disconnects.
- 4. service grounding.
- 5. interior components of service panels and sub panels.

OVERVIEW ROOFING EXTERIOR STRUCTURE ELECTRICAL HEATING COOLING INSULATION PLUMBING INTERIOR

RECALCHEK OUR ADVICE APPENDIX REFERENCE

- 6. distribution conductors.
- 7. overcurrent protection devices.
- 8. a *representative number* of *installed* lighting fixtures, switches, and receptacles.
- 9. ground fault circuit interrupters (GFCI).
- 10. arc fault circuit interrupters (AFCI).
- 11. smoke alarms.
- 12. carbon monoxide alarms.

8.2 THE INSPECTOR IS NOT REQUIRED TO:

A. inspect:

- 1. remote control devices unless the device is the only control device.
- 2. alarm systems and components.
- 3. low voltage wiring, systems and components.
- ancillary wiring, systems and components not a part of the primary electrical power distribution system.
- 5. telecommunication equipment.

B. measure:

1. amperage, voltage, or impedance.

C. operate or test:

- 1. smoke alarms.
- 2. carbon monoxide alarms.

9. HEATING SYSTEMS

9.1 THE INSPECTOR SHALL:

A. inspect:

- 1. installed heating equipment.
- 2. vent systems, flues, and chimneys.
- 3. fuel storage and distribution systems.

9.2 THE INSPECTOR IS NOT REQUIRED TO:

A. inspect:

- 1. interiors of flues or chimneys.
- 2. heat exchangers.
- 3. auxiliary equipment.
- 4. solar heating *systems*.

B. determine:

1. system adequacy or distribution balance.

10. FIREPLACES AND SOLID FUEL BURNING APPLIANCES

10.1 THE INSPECTOR SHALL:

A. inspect:

- 1. fireplace and solid fuel burning system components.
- 2. vent systems and chimneys.

B. describe:

1. fireplaces and solid fuel burning appliances.

10.2 THE INSPECTOR IS NOT REQUIRED TO:

A. inspect:

1. interior of flues or chimneys.

- 2.screens, doors and dampers.
- 3. seals and gaskets.
- 4. automatic fuel feed devices.
- 5. heat distribution systems whether fan-assisted or convection.

www.carsondunlop.com

- B. ignite or extinguish fires or pilot lights.
- C. determine draft characteristics.
- D. move fireplace inserts, stoves, or firebox contents.

11. AIR CONDITIONING SYSTEMS

11.1 THE INSPECTOR SHALL:

A. inspect

1. permanently *installed* air conditioning equipment.

11.2 THE INSPECTOR IS NOT REQUIRED TO:

A. inspect

1. portable air conditioners.

B. determine:

1. system adequacy or distribution balance.

12. INTERIOR SYSTEMS

12.1 THE INSPECTOR SHALL:

A. inspect:

- 1. walls, ceilings, and floors.
- 2. stairs, guards and handrails.
- 3. a *representative number* of countertops and *installed* cabinets.
- 4. a representative number of doors and windows.
- 5. gas proofing of walls, doors and ceilings separating the habitable spaces and the garage.
- 6. fire separations.

12.2 THE INSPECTOR IS NOT REQUIRED TO:

A. inspect:

- 1. decorative finishes.
- 2. window treatments.
- 3. central vacuum systems.
- 4. household appliances.
- 5. recreational facilities.

13. INSULATION AND VAPOUR RETARDERS

13.1 THE INSPECTOR SHALL:

A. inspect:

1. insulation and vapour retarders.

B. describe:

1. type of insulation materials and *vapour retarders* in unfinished spaces.

13.2 THE INSPECTOR IS NOT REQUIRED TO:

A. disturb:

- 1. insulation.
- 2. vapour retarders

OVERVIEW ROOFING EXTERIOR STRUCTURE ELECTRICAL HEATING COOLING INSULATION PLUMBING INTERIOR

RECALCHEK OUR ADVICE APPENDIX REFERENCE

14. MECHANICAL AND NATURAL VENTILATION SYSTEMS

14.1 THE INSPECTOR SHALL:

A. inspect:

- 1. ventilation of attics and foundation areas.
- 2. mechanical ventilation systems.
- the ventilation systems in areas where moisture is generated such as kitchens, bathrooms, laundry rooms.

14.2 THE INSPECTOR IS NOT REQUIRED TO:

B. determine:

- 1. indoor air quality.
- 2. system adequacy or distribution balance.

GLOSSARY

Adjacent

Nearest in space or position; immediately adjoining without intervening space.

Alarm Systems

Warning devices, installed or free-standing, including but not limited to; carbon monoxide alarms, flue gas and other spillage alarms, security equipment, ejector pumps and smoke alarms

Architectural Service

Any practice involving the art and science of building design for construction of any structure or grouping of structures and the use of space within and surrounding the structures or the design for construction, including but not specifically limited to, schematic design, design development, preparation of construction contract documents, and administration of the construction contract, adequacy of design for the location and exposure to the elements.

Automatic Safety Controls

Devices designed and installed to protect *systems* and *components* from unsafe conditions.

Component

A part of a system.

Crawl Space

The area within the confines of the foundation and between the ground and the underside of the floor.

Decorative

Ornamental; not required for the operation of *systems* and *components* of a building.

Describe

To *report* a *system* or *component* by its type or other observed, significant characteristics to distinguish it from other *systems* or *components*.

Determine

To find out, or come to a conclusion by investigation.

Dismantle

To take apart or remove any component, device, or piece of equipment that would not be taken apart or removed by a homeowner in the course of normal and routine homeowner maintenance.

Engineering Service

Any professional service or creative work requiring engineering education, training, and experience and the application of special knowledge of the mathematical, physical and engineering sciences to such professional service or creative work as consultation, investigation, evaluation, planning, design and supervision of construction for the purpose of assuring compliance with the specifications and design, in conjunction with structures, buildings, machines, equipment, works or processes.

Functionality

The purpose that something is designed or expected to fulfill.

Further Evaluation

Examination and analysis by a qualified professional, tradesperson or service technician beyond that provided by the *home inspection*.

2023 National Standards of Practice. © Copyright 2023 Canadian Association of Home & Property Inspectors. All Rights Reserved.

www.carsondunlop.com

www.carsondunlop.com

OVERVIEW ROOFING EXTERIOR STRUCTURE ELECTRICAL HEATING COOLING INSULATION PLUMBING INTERIOR

RECALCHEK OUR ADVICE APPENDIX REFERENCE

Home and Property Inspection

The process by which an *inspector* visually examines the *readily accessible systems* and *components* of a building in accordance with these National Standards of Practice.

Household Appliances

Kitchen, laundry, and similar appliances, whether *installed* or freestanding.

Inspect

To examine *readily accessible systems* and *components* of a building in accordance with these National Standards of Practice, *where applicable* using *normal operating controls* and opening *readily openable access panels*.

Inspector

A person hired to examine any *system* or *component* of a building in accordance with these National Standards of Practice.

Installed

Set up or fixed in position for current use or service.

Mechanical Ventilation Systems

An active or powered air exhaust and/or intake system installed to remove moisture or contaminants from, or introduce fresh air into, the living space.

Normal Operating Controls

Devices such as thermostats, switches or valves intended to be operated by the homeowner.

Operate

To cause to function, turn on, to control the function of a machine, process, or system.

Readily Accessible

Available for visual inspection without requiring moving of personal property, *dismantling*, destructive measures, or any action which will likely involve risk to persons or property.

Readily Openable Access Panel

A panel provided for homeowner inspection and maintenance that is within normal reach, can be removed by one person, and is not sealed in place.

Recreational Facilities

Spas, saunas, steam baths, swimming pools, exercise, entertainment, athletic, playground or other similar equipment and associated accessories.

Report

To communicate in writing.

Representative Number

One *component* per room for multiple similar interior *components* such as windows and electric outlets; one *component* on each side of the building for multiple similar exterior *components*.

Roof Drainage Systems

Components used to carry water off a roof and away from a building.

Sample

A representative portion selected for inspection.

Service Life/Lives

The period during which something continues to function fully as intended.

Shut Down

A state in which a *system* or *component* cannot be operated by *normal operating controls*.

Significant Deficiency

A clearly definable hazard or a clearly definable potential for failure or is unsafe or not functioning.

Solid Fuel Burning Appliances

A hearth and fire chamber or similar prepared place in which a fire may be built, and which is built in conjunction with a chimney; or a listed assembly of a fire chamber, its chimney and related factory-made parts designed for unit assembly without requiring field construction.

Spa

Residential recreational or therapeutic device.

Structural Component

A component that supports non-variable forces or weights (dead loads) and variable forces or weights (live loads).

System

A combination of interacting or interdependent components, assembled to carry out one or more functions.

Technically Exhaustive

An inspection is technically exhaustive when it is done by a specialist who may make extensive use of measurements, instruments, testing, calculations, and other means to develop scientific or engineering findings, conclusions, and recommendations.

Technical Services

Services that involve dismantling, the extensive use of advanced techniques, measurements, instruments, tools, testing, calculations, or other similar methods.

APPENDIX Report No. 93897, v.2

82 Salem Ave, Toronto, ON September 5, 2025

www.carsondunlop.com

OVERVIEW ROOFING EXTERIOR STRUCTURE ELECTRICAL HEATING COOLING INSULATION PLUMBING INTERIOR

RECALCHEK OUR ADVICE APPENDIX REFERENCE

Unsafe

A condition in a *readily accessible, installed system* or *component* which is judged to be a significant risk of personal injury during normal, day-to-day use. The risk may be due to damage, deterioration, missing or improper installation or a change in accepted residential construction Standards.

Vapour Retarder

Material used in the building envelope to retard the passage of water vapour.

Visually Accessible

Able to be viewed by reaching or entering.

Note - In these National Standards of Practice, redundancy in the description of the requirements, limitations and exclusions regarding the scope of the Home and Property Inspection is provided for clarity not emphasis.

(CAHPI acknowledges The American Society of Home Inspectors*, Inc. (ASHI*) for the use of their Standards of Practice (version January 1, 2000)

(JANUARY 25, 2023 VER.G)

REFERENCE LIBRARY

82 Salem Ave, Toronto, ON September 5, 2025

www.carsondunlop.com

OVERVIEW ROOFING EXTERIOR STRUCTURE ELECTRICAL HEATING COOLING INSULATION PLUMBING INTERIOR

RECALCHEK OUR ADVICE APPENDIX REFERENCE

The links below connect you to a series of documents that will help you understand your home and how it works. These are in addition to links attached to specific items in the report.

Click on any link to read about that system.

- 01. ROOFING, FLASHINGS AND CHIMNEYS
- 02. EXTERIOR
- 03. STRUCTURE
- 04. ELECTRICAL
- 05. HEATING
- 06. COOLING/HEAT PUMPS
- 07. INSULATION
- 08. PLUMBING
- 09. INTERIOR
- 10. APPLIANCES
- 11. LIFE CYCLES AND COSTS
- 12. SUPPLEMENTARY

Asbestos

Radon

Urea Formaldehyde Foam Insulation (UFFI)

Lead

Carbon Monoxide

Mold

Household Pests

Termites and Carpenter Ants

- 13. HOME SET-UP AND MAINTENANCE
- 14. MORE ABOUT HOME INSPECTIONS



Minelli Maintenance Ltd

INVOICE INV445

ESRA/ESA # 7012658 WSIB # 6375619

DATE

Sep 18, 2025

Business Number

DUE

807163365RT001

On Receipt

2825 Islington Ave.

On Receipt

Unit # 712

BALANCE DUE

North York, Ontario, M9L 2K1

CAD \$220.35

1 (416) 904-4936

marco_pinelli@live.ca

BILL TO

Trava Realty

Regarding:

82 Salem Ave

+16478919473

tradecraftcommercial@gmail.com

DESCRIPTION		RATE	QTY	AMOUNT
- Remove visible knob and tube wiring				
- Install new GFI in basement bathroom		\$275.00) 1	\$275.00
Payment Info	SUBTOTAL HST (13%)			\$275.00 \$35.75
BY CHECK Minelli Maintenance Ltd	TOTAL			\$310.75
				LANCE DUE \$310.75

Thanks for your business! We hope you are satisfied with our work. Please remit payment upon receiving invoice.

Questions? Comments? Contact us at (416) 904-4936 or email us at marco@minellielectric.com, we'll be happy to answer any questions or concerns.